



INSTALLATION GUIDE

PERFORMANCE INTERCOOLER PIPE UPGRADE KIT FITS 2021+ BRONCO 2.3L W/ HIGH-MOUNT INTERCOOLER SKU: MMICP-BR23-21UH

TABLE OF CONTENTS

- Pg 1** RESOURCES AND CONTACT INFORMATION
- Pg 2** EXPLODED VIEW DIAGRAM
- Pg 3** IMPORTANT SAFETY INFORMATION
INSTALLATION INSTRUCTIONS
- Pg 5** DISPOSAL INSTRUCTIONS
WARRANTY INFORMATION

RESOURCES & CONTACT


-  **CALL 1-877-GOMISHI**
CUSTOMER SERVICE HOURS: MON-FRI 8:30AM-5:00PM EST
-  **MISHIMOTO**
-  **GOMISHIMOTO**
-  **MISHIMOTO**
-  **WEBSITE**
WWW.MISHIMOTO.COM
-  **ENGINEERING BLOG**
WWW.MISHIMOTO.COM/ENGINEERING

PARTS BREAKDOWN

PART NUMBER	DESCRIPTION	QTY
MM2425-01	HOT-SIDE PIPE	1
MM2425-02	COLD-SIDE PIPE	1
MM4623-01	TURBO BOOT	1
MM4623-02	THROTTLE BODY BOOT	1
MM4634-01	INTERCOOLER BOOT	2
MM1533-66	HD WG CLAMP (45-66MM)	1
MM1533-79	HD WG CLAMP (57-79MM)	1

PARTS BREAKDOWN

PART NUMBER	DESCRIPTION	QTY
MM1533-92	HD WG CLAMP (70-92MM)	6
MM1281-15	GROMMET	1
BL6X1.0-16	BUTTON HEAD LOCKING BOLT (16MM LONG)	3
HF6X1.0-20A	HEX HEAD FLANGE BOLT (20MM LONG)	1
HF6X1.0-30D	HEX HEAD FLANGE BOLT (30MM LONG)	1
MM1165-07	1/8" NPT PLUG	1

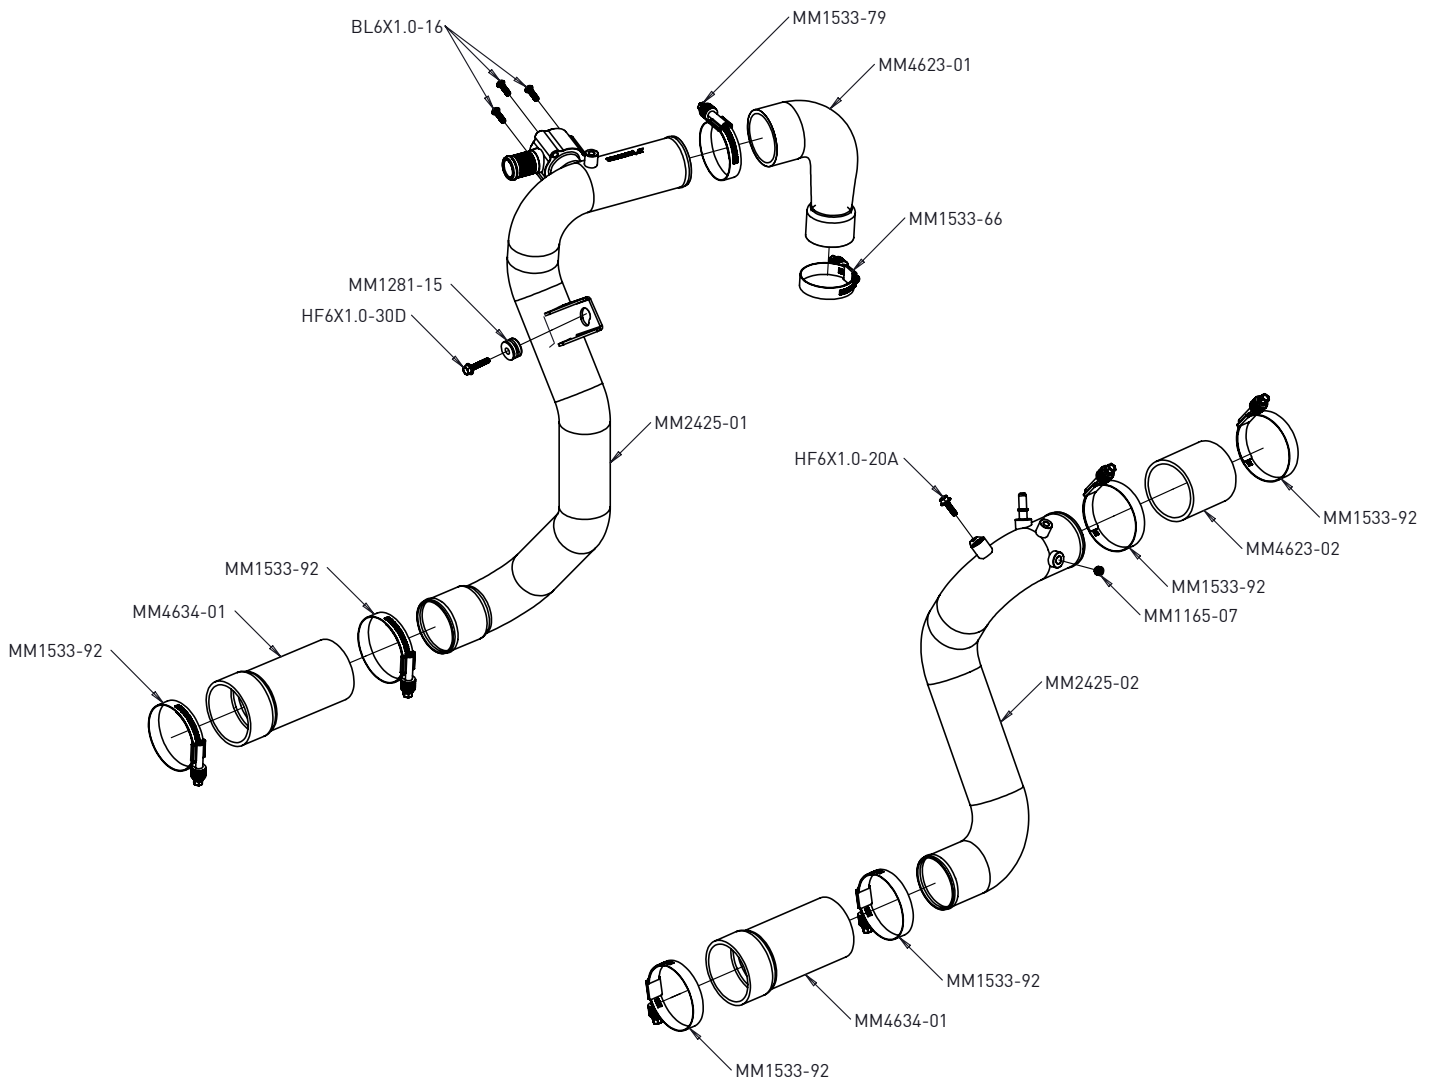

IMPORTANT SAFETY INFORMATION

- › Mishimoto recommends you use safety glasses and protective gloves during the installation of our products
- › Raise vehicle only on jack stands or on a vehicle lift
- › Allow vehicle to cool completely prior to attempting installation
- › Do not run the engine or drive the vehicle while overheating; serious damage can occur
- › Please dispose of any liquids properly
- › Mishimoto is not responsible for any vehicle damage or personal injury due to installation errors, misuse, or removal of Mishimoto products
- › If you need any assistance while installing our products, reach out to our Customer Service Team at 1-877-GOMISHI

REQUIRED TOOLS

2.5 MM ALLEN WRENCH
 7 MM SOCKET
 8 MM SOCKET
 10 MM SOCKET
 15 MM SOCKET
 1/4"-DRIVE RATCHET AND EXTENSION
 3/8"-DRIVE RATCHET AND EXTENSION
 1/4"-DRIVE TORQUE WRENCH
 PANEL TOOL
 PLIERS
 PICK TOOL
 T30 TORX

INSTALL TIME 2.5 HOURS


INSTALL DIFFICULTY 

INSTALLATION INSTRUCTIONS

1. Remove the front skid plate.
2. Remove the blue quick disconnect adapter and boot from the Mishimoto high-mount intercooler.



3. Disconnect the TMAP sensor electrical harness and vacuum line from the cold-side intercooler pipe.
4. Loosen the clamp securing the cold-side intercooler pipe to the throttle body, then remove the cold-side intercooler pipe.
5. Remove the bypass valve hose from the bypass valve.
6. Disconnect the bypass valve electrical harness.
7. Loosen the clamp securing the hot-side intercooler pipe to the turbo.
8. Disconnect the two vacuum lines attached to the air intake tube.
9. Remove the 8mm bolt securing the hot-side intercooler pipe to the bracket on the front of the engine, then remove the hot-side intercooler pipe.
10. Transfer the TMAP sensor from the stock cold-side intercooler pipe to the Mishimoto cold-side intercooler pipe and secure it in place using the provided hardware. (Flange-Head M6X1.0-20)

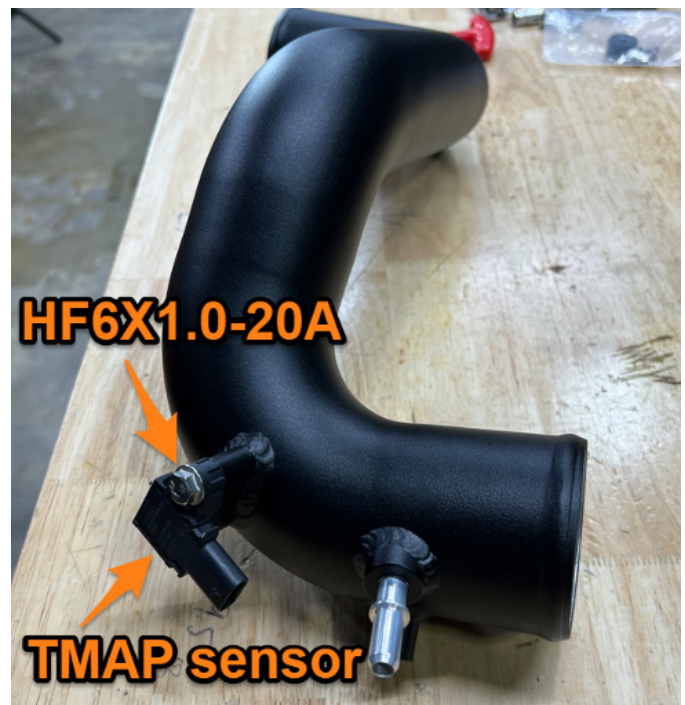

Continued on next page


11. Transfer the bypass valve from the stock hot-side intercooler pipe to the Mishimoto hot-side intercooler pipe and secure it in place using the provided hardware. (3x Button-Head M6X1.0-16)



12. Install the provided grommet onto the Mishimoto hot-side intercooler pipe. (MM1281-15)



13. Using the provided clamps and turbo boot, install the Mishimoto hot-side intercooler pipe. Do not tighten the clamps, this will be done later. Reconnect the bypass valve hose and electrical harness. (MM4623-01, MM1533-66, and MM1533-79)

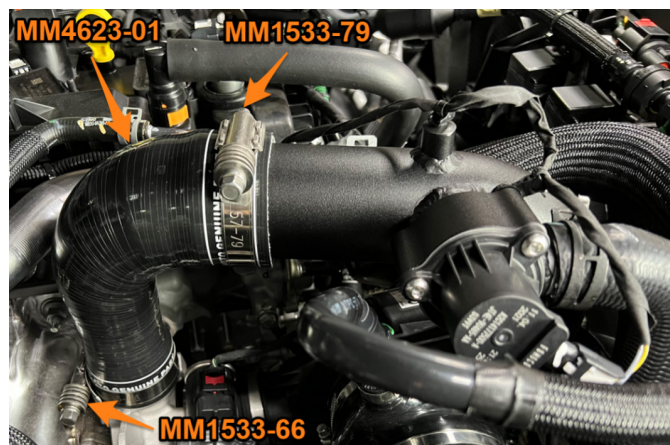


14. Secure the Mishimoto hot-side intercooler pipe to the bracket on the front of the engine using the provided hardware. (Flange-Head M6X1.0-30)

15. Reconnect the two vacuum lines to the air intake tube.

16. Using the provided clamps and throttle body boot, install the Mishimoto cold-side intercooler pipe. Do not tighten the clamps, this will be done later. Reconnect the TMAP sensor electrical harness and vacuum line. (MM4623-02 and 2x MM1533-92)



17. Connect the Mishimoto hot and cold-side intercooler pipes to the Mishimoto high-mount intercooler using the provided boots and clamps. (2x MM4634-01, and 4x MM1533-92)

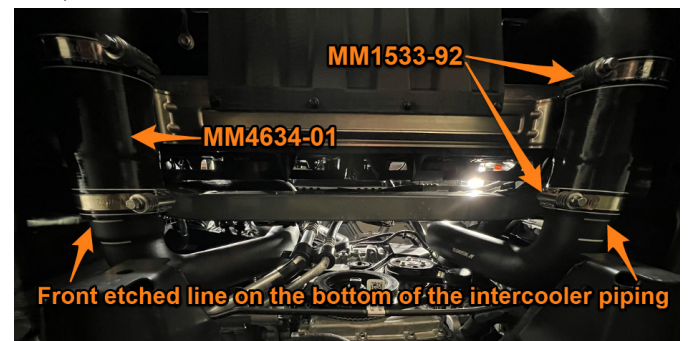

18. Check to make sure the Mishimoto intercooler piping is not touching any of the pulleys on the front of the engine. Once proper clearance around the piping is confirmed, tighten all the clamps.

19. Reinstall the front skid plate.

Congratulations! You have finished your installation!

Continued on next page

DISPOSAL INSTRUCTIONS

- › Do not dispose of any product as unsorted municipal waste. Use separate collection facilities. Contact your local authority for information regarding the collection systems available.
- › Never improperly dispose of any coolant, oil, or other chemicals.

WARRANTY INFORMATION



- › All claims must be accompanied with a picture of the Mishimoto product showing the issue for which the claim is being submitted.
- › Mishimoto asks that the customer inspect their purchased item for any damage immediately upon arrival.
- › Any product deemed dead on arrival (DOA) must be claimed within 14 business days of delivery. Claims outside of this time frame will not be covered under the Mishimoto Lifetime Warranty.
- › This warranty does not include payment and/or reimbursement of the cost of labor in connection with the removal of any product returned pursuant to the warranty policy or in connection with the installation of any replacement items provided under the warranty policy.
- › Mishimoto has the right to refuse a claim at any time.

- › When Mishimoto accepts a claim, Mishimoto retains full discretion to choose if it will: (i) repair or replace purchaser's original Mishimoto product; (ii) replace purchaser's original Mishimoto product with the most current available model; or (iii) provide the purchaser with a gift card redeemable on [Mishimoto.com](https://www.mishimoto.com) in the amount of the original purchase price of the original Mishimoto product. The provision of a replacement of a Mishimoto product is subject to availability and Mishimoto retains the right to substitute any warranty claim item with a comparable item or credit at any time.
- › If Mishimoto determines that it will provide a replacement item in connection with a claim under this warranty policy, and such item is out of stock, Mishimoto will place the customer on backorder and ship the replacement product to the purchaser once it becomes available.
- › Mishimoto is not liable for incorrect shipments in connection with a claim if a claim form is completed incorrectly, or if a model number is not included in a claim.
- › If you have a vehicle equipped with an automatic transmission, please make sure to specify this within the text box on the claim form. Mishimoto is not responsible for incorrect replacement shipments if transmission type is not indicated.



WARNING
Cancer and
Reproductive Harm
www.P65Warnings.ca.gov

This product can expose you to chemicals which are known to the state of California to cause cancer. For more information visit: www.p65warnings.ca.gov